TROUBLE SHOOTING FOR MODELS AH-15 & AH-TM

PROBLEM		POSSIBLE CAUSE(S)
AIR LEAK, LOSS OF POWER	3-114 O-RING	WORN OR DAMAGED WORN OR DAMAGED CRACKED BORE OR EXTREME WEAR LOOSE LOOSE
TOOL WILL NOT CYCLE, TIP EXTENDED, LEAKING AIR	156 HOUSING	BORE SMASHED OUT
	158 VALVE	WORN, SEPARATION OF RUBBER TO METAL BOND. RUBBER EXPOSED TO DETERGENT OIL AND/OR SOLVENTS.
TOOL WILL NOT CYCLE, TIP RETRACTED	161 EXHAUST SEAT	WORN, SEPARATION OF RUBBER TO METAL BOND.RUBBER EXPOSED TO DETERGENT OIL AND/OR SOLVENTS.
RUNS ERRATIC AND/OR TIP EXTENDED OR RETRACTED WITH LEAKING AIR.	161 EXHAUST SEAT	WORN, SEPARATION OF RUBBER TO METAL BOND
,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	328 PISTON	LOOSE
LOSS OF POWER, RUNS ERRATIC OR WON'T RUN, LEAKING AIR	156 HOUSING	WORN BORE
	159 STEM	CRACKED OR BROKEN CUP OR BROKEN STEM
	160 SLEEVE 4-218 O-RING	CRACKED WORN OR DAMAGED
TOOL WILL NOT CYCLE AND BLOWS AIR	163 BUMPER	CHIPPED OR CRACKED (WHEN CHANGING 163 BUMPER ALSO CHECK BOTH 4-212 O-RINGS AND REPLACE IF DAMAGED).
HAMMERS SLOW AND HARD	161 EXHAUST SEAT	INSTALLED UPSIDE DOWN OR RUBBER MISSING.
TOOL RUNS AUTOMATIC	4-212 O-RING	WORN, DAMAGED, OR MISSING.
TOOL RUNS SLOWAND HANGS UP		LACK OF LUBRICATION. USE OF DETERGENT OILS. USE OF SOLVENTS IN CLEANING RUBBER PARTS.
LOSS OF POWER		DEBRIS IN AIR LINES. RESTICTED AIR SUPPLY (TO INSURE MAXIMUM AIR FLOW FOR PROPER OPERATION WE RECOMMEND 3/8" HOSE / FITTINGS).